



**Australian Government**

**Australian Transport Safety Bureau**

## **Debris examination – update No. 4**

# **Missing aircraft, Boeing 777, 9M-MRO, 8 March 2014**

**Preliminary examination of two items of  
debris recovered near Sainte Luce,  
Madagascar**

**ATSB Technical Examination Report**

Aviation

AE-2014-054

Debris examination update 4

Released in accordance with section 25 of the *Transport Safety Investigation Act 2003*

**Publishing information**

**Published by:** Australian Transport Safety Bureau  
**Postal address:** PO Box 967, Civic Square ACT 2608  
**Office:** 62 Northbourne Avenue Canberra, Australian Capital Territory 2601  
**Telephone:** 1800 020 616, from overseas +61 2 6257 4150 (24 hours)  
Accident and incident notification: 1800 011 034 (24 hours)  
**Facsimile:** 02 6247 3117, from overseas +61 2 6247 3117  
**Email:** [atsbinfo@atsb.gov.au](mailto:atsbinfo@atsb.gov.au)  
**Internet:** [www.atsb.gov.au](http://www.atsb.gov.au)

© Commonwealth of Australia 2016



**Ownership of intellectual property rights in this publication**

Unless otherwise noted, copyright (and any other intellectual property rights, if any) in this publication is owned by the Commonwealth of Australia.

**Creative Commons licence**

With the exception of the Coat of Arms, ATSB logo, and photos and graphics in which a third party holds copyright, this publication is licensed under a Creative Commons Attribution 3.0 Australia licence.

Creative Commons Attribution 3.0 Australia Licence is a standard form license agreement that allows you to copy, distribute, transmit and adapt this publication provided that you attribute the work.

The ATSB's preference is that you attribute this publication (and any material sourced from it) using the following wording: *Source:* Australian Transport Safety Bureau

Copyright in material obtained from other agencies, private individuals or organisations, belongs to those agencies, individuals or organisations. Where you want to use their material you will need to contact them directly.

**Addendum**

| Page | Change | Date |
|------|--------|------|
|      |        |      |
|      |        |      |

## Missing aircraft, Boeing 777, 9M-MRO, 8 March 2014

### *Preliminary examination of two items of debris recovered near Sainte Luce, Madagascar*

#### **Introduction**

Two items of fibreglass-honeycomb composite debris were recovered near Sainte Luce on the south-east coast of Madagascar, having reportedly washed ashore in February 2016. They were hand-delivered to the Australian Transport Safety Bureau on 12 September 2016. The items were initially reported in the media as being burnt.

This document summarises the ATSB's preliminary examination of the items for any evidence of exposure to heat or fire.

#### **Examination**


No manufacturing identifiers, such as a part numbers or serial numbers were present on either item, that may have provided direct clues as to their origin. At the time of writing, the items had not been identified and work in this respect is ongoing.

A dark grey colouration was present on a significant proportion of both sides of each item (Figures 1, 2 and 3). Detailed examination of these areas showed that the colour related exclusively to a translucent resin that had been applied to those surfaces (Figure 4).

A cross section through the panel showed a clear delineation between the dark resin and the other surface coatings without any evidence of gradual transition. The lighter grey surface areas resulted from a thinner film of the same resin applied over an off-white background. Figure 5 shows the cross section directly and Figure 6 shows the same section at an oblique angle. This confirmed that the dark colour of the coating was an inherent property of the resin, and not the result of exposure to heat or fire.

Despite no evidence of overall gross heat damage, two small (<10mm) marks on one side of the larger item and one on the reverse side were identified as damage resulting from localised heating (Figures 2 and 3). A burnt odour emanating from the large item was isolated to these discrete areas. The origin and age of these marks was not apparent. However, it was considered that burning odours would generally dissipate after an extended period of environmental exposure, including salt water immersion, as expected for items originating from 9M-MRO.

**Figure 1: Smaller composite panel**

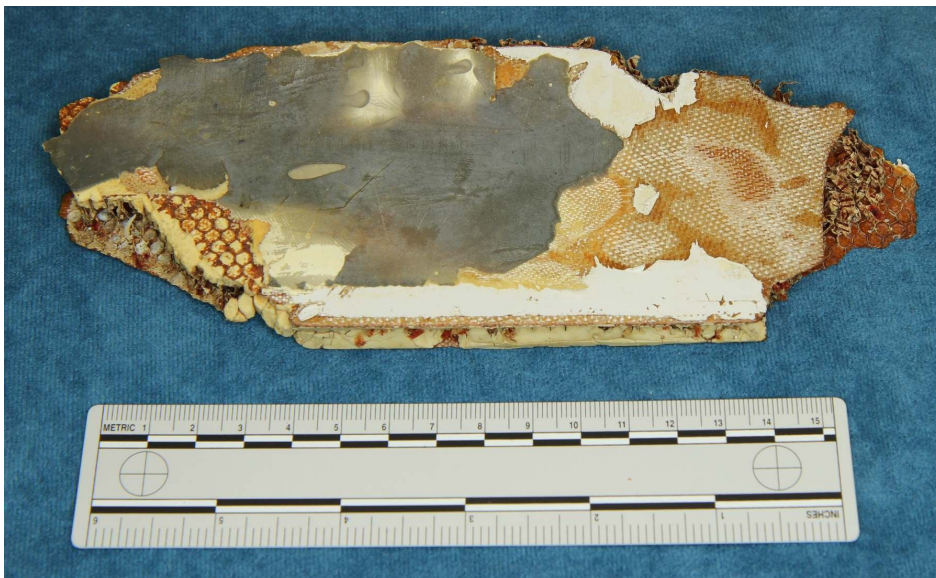

Source: ATSB

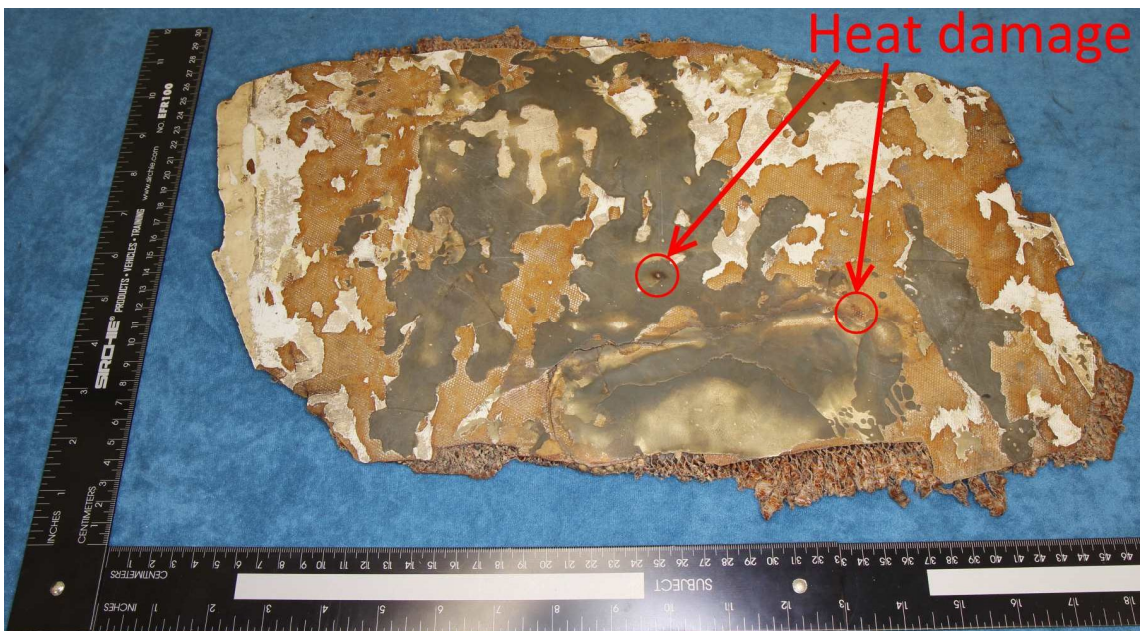


Figure 2: Larger composite panel showing discrete area of heat damage



Source: ATSB

Figure 3: Reverse side of larger composite panel showing discrete areas of heat damage



Source: ATSB



**Figure 4: Close-up of applied coatings**




Source: ATSB

**Figure 5: Cross-section through composite skin, showing surface colouration through thickness.**



Source: ATSB

**Figure 6: Higher magnification image of Figure 5, showing clear delineation between layers**

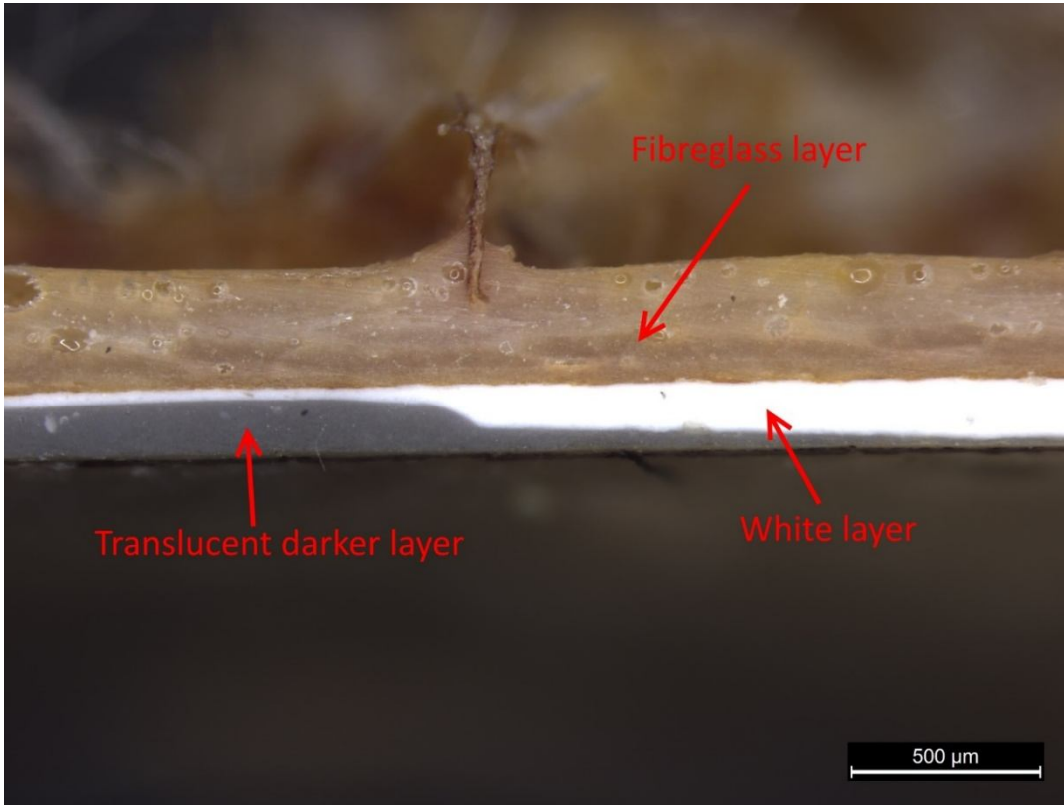

Source: ATSB

### Summary

The following findings were made during a preliminary examination of two items of composite debris, recovered near Sainte Luce, Madagascar. At the time of writing, work is ongoing to determine the origin of the items, specifically, whether they originated from a Boeing 777 aircraft.

- 1) The dark grey colouration on the outer surfaces of the items related to an applied resin and was not the result of exposure to heat or fire.
- 2) Three small marks on the larger item were indicative of localised heating. The age and origin of these marks was not apparent.